


TYPE
01

DETAIL DESCRIPTION : SECTION_Typical aluminium window casement connection with u/s of lintel plastered in.


SCALE : 1:2.5

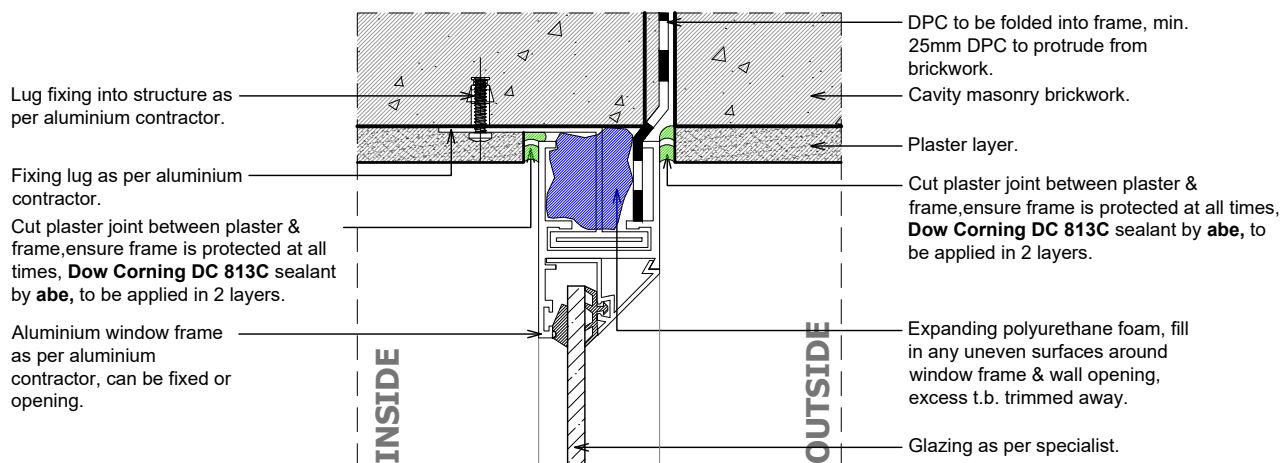

TYPE
02

DETAIL DESCRIPTION : SECTION_Typical Shop Front connection with u/s of lintel plastered in.


SCALE : 1:2.5

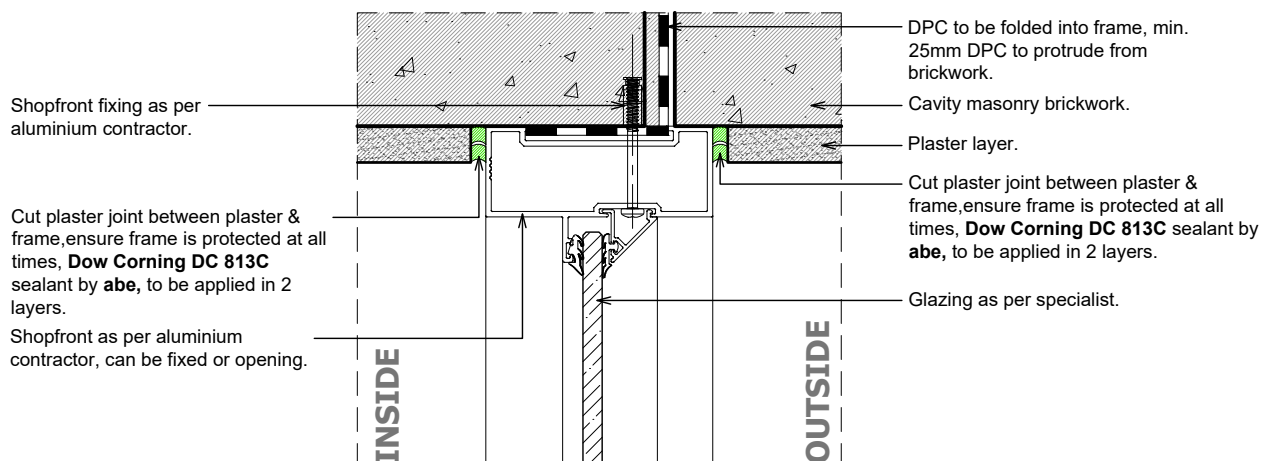


GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.
Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.
Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

TYPE 03	DETAIL DESCRIPTION : SECTION_Typical unfinished Concrete Soffit/ Beam/ Masonry connection with aluminium window frame.	SCALE : 1:2.5
-------------------	--	---------------

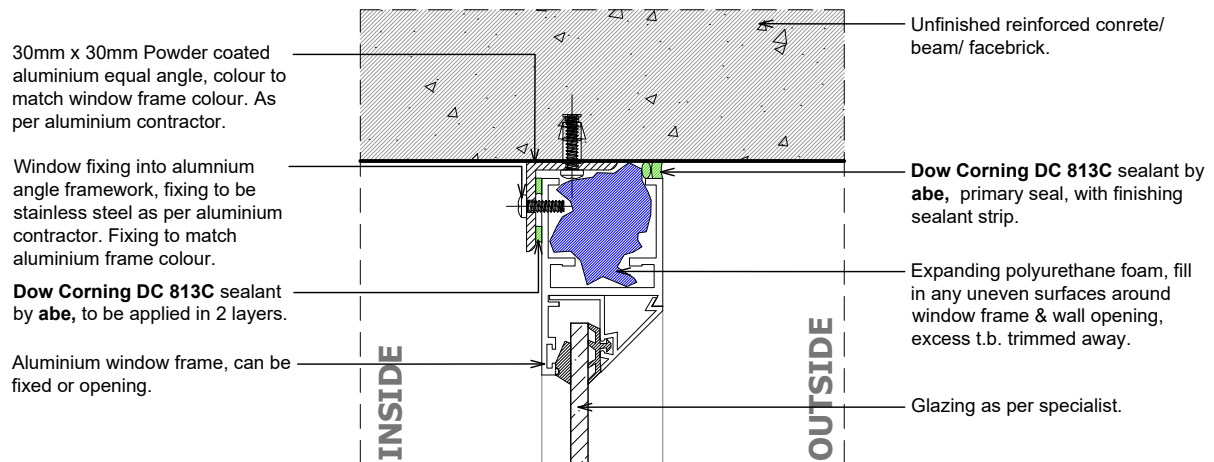


TYPE 04	DETAIL DESCRIPTION : SECTION_Typical unfinished Concrete Soffit/ Beam/ Masonry connection with aluminium shop front.	SCALE : 1:2.5
-------------------	--	---------------

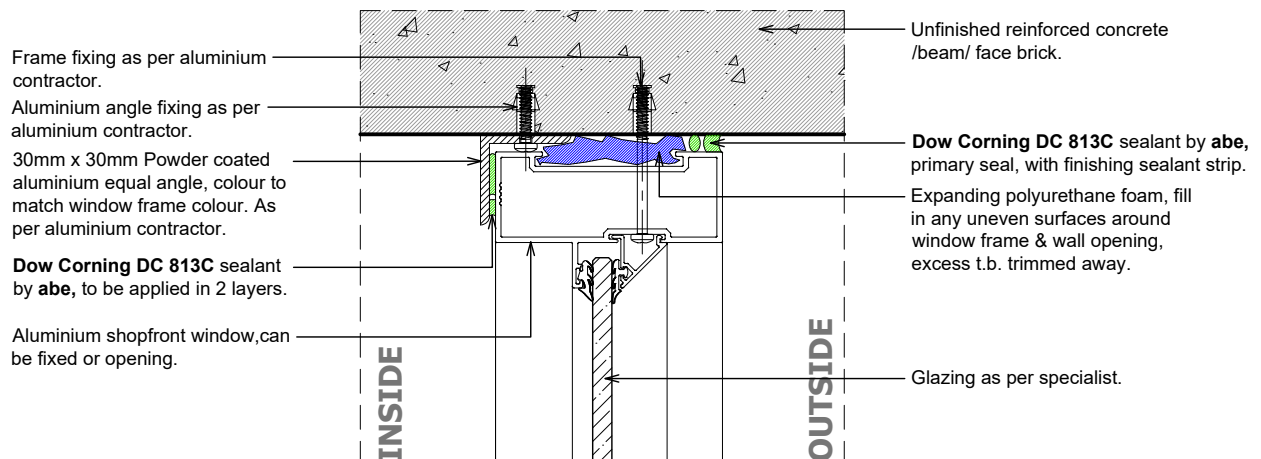


GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.
Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.
Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

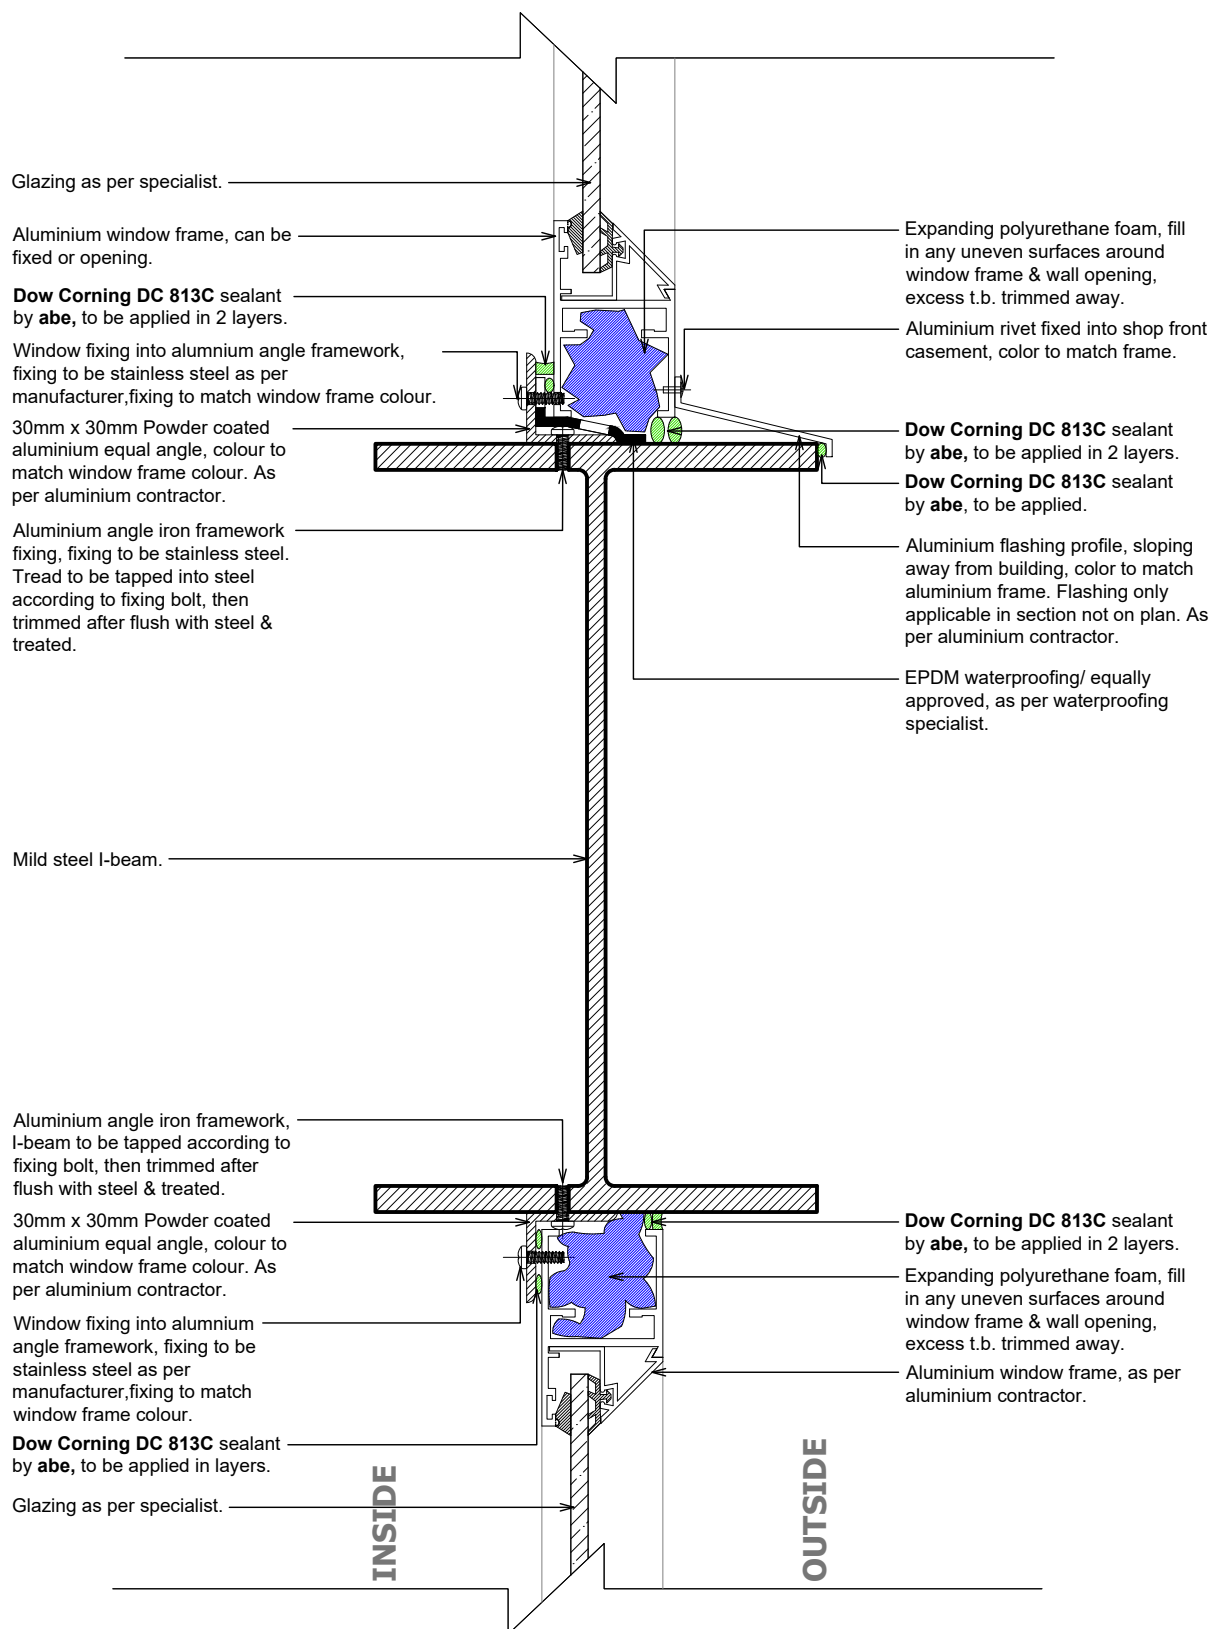

GENERAL NOTE :


Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.
Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.
Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

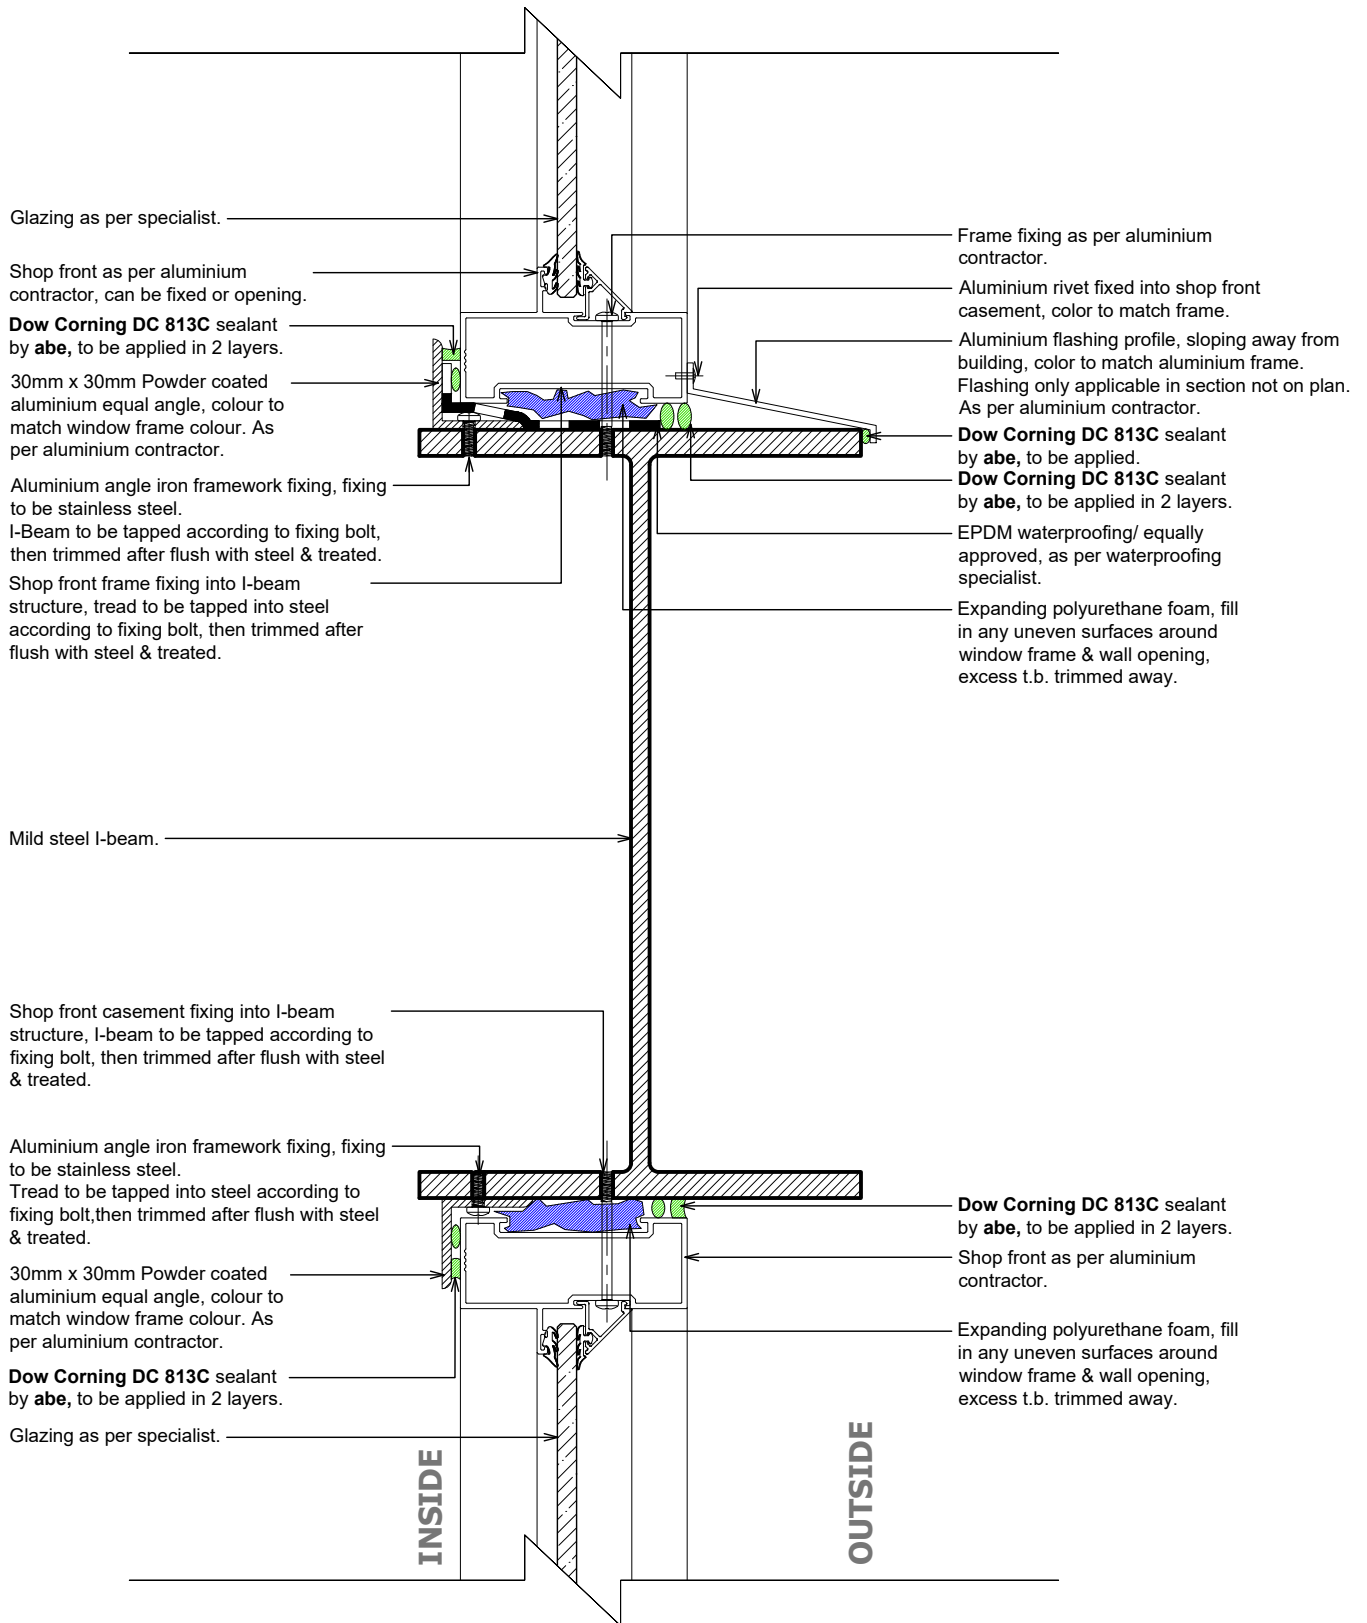


GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.
Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.
Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

07

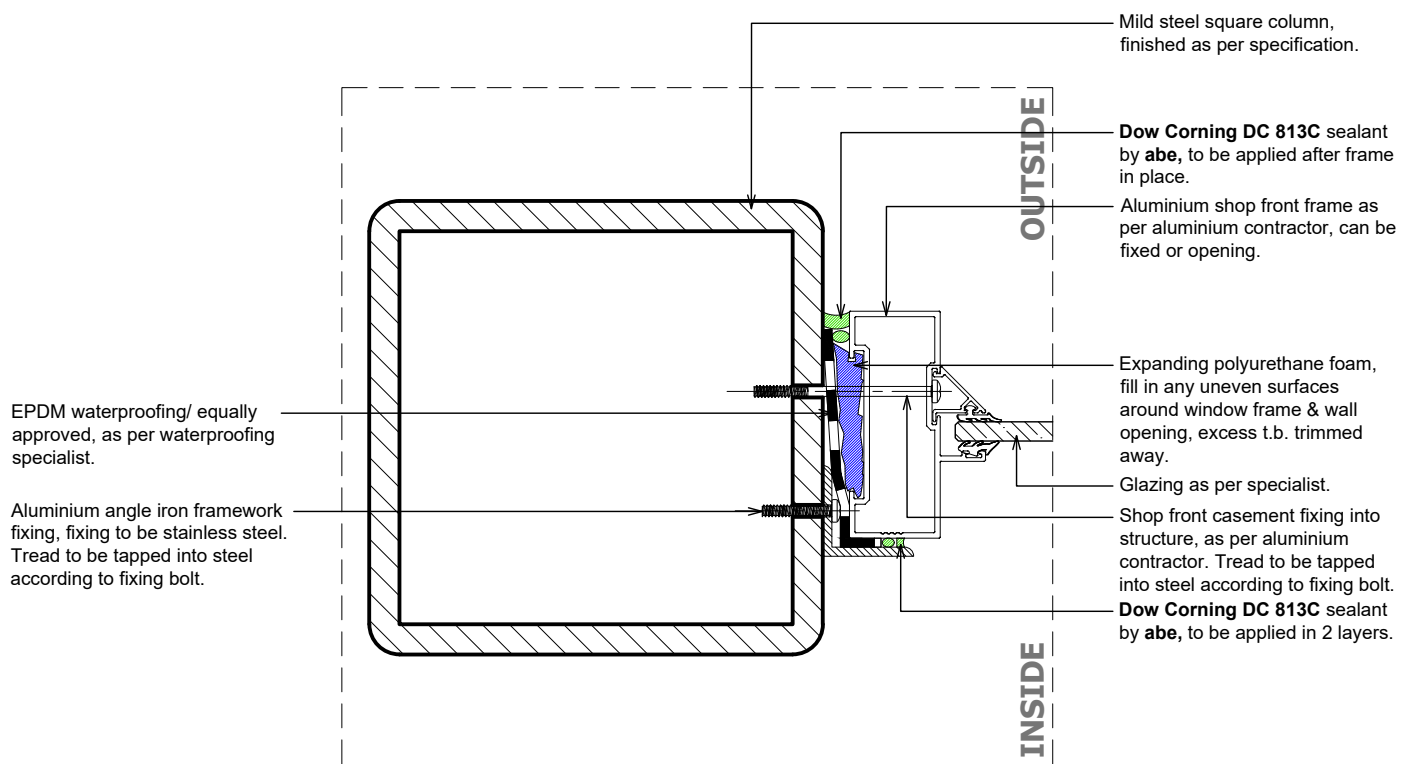

08


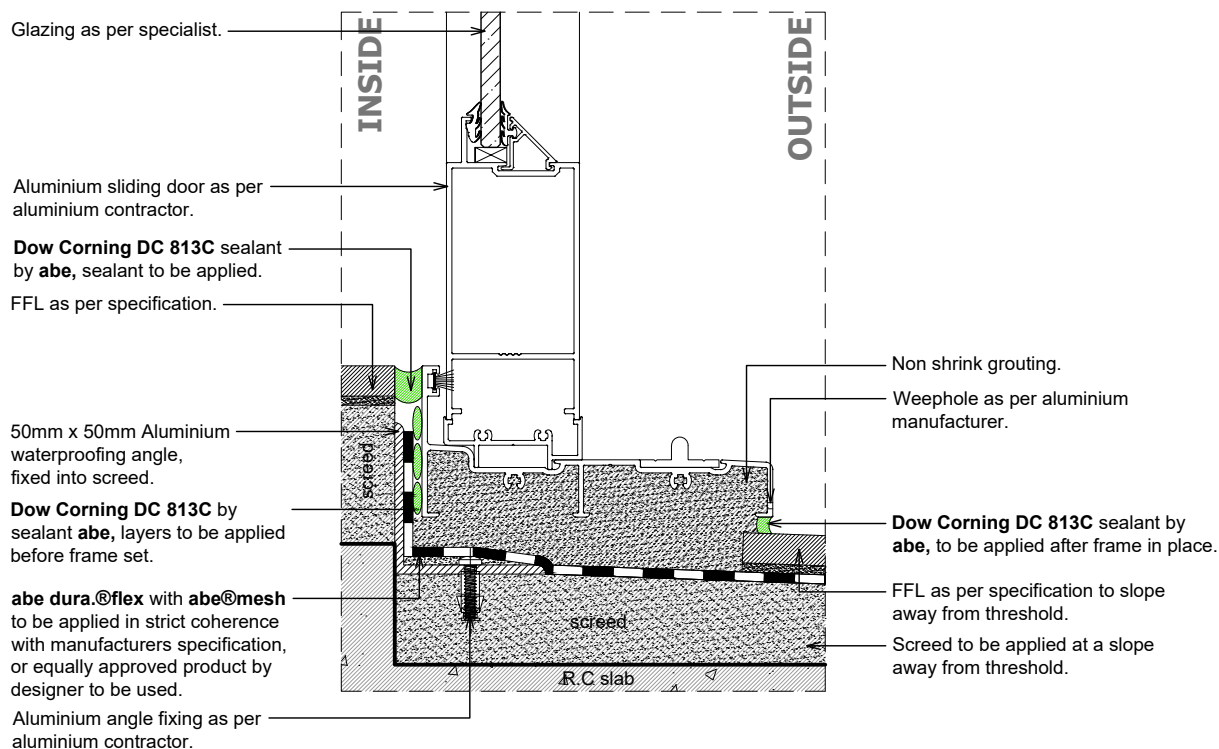


GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.

Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.

Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

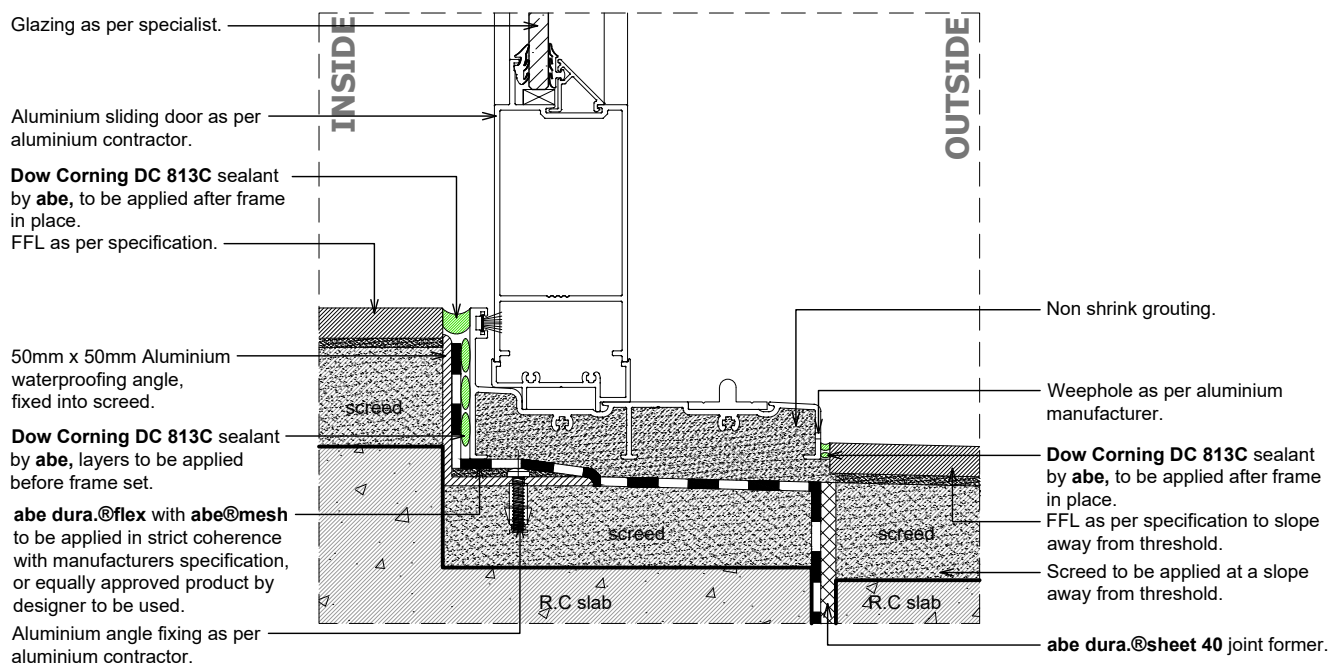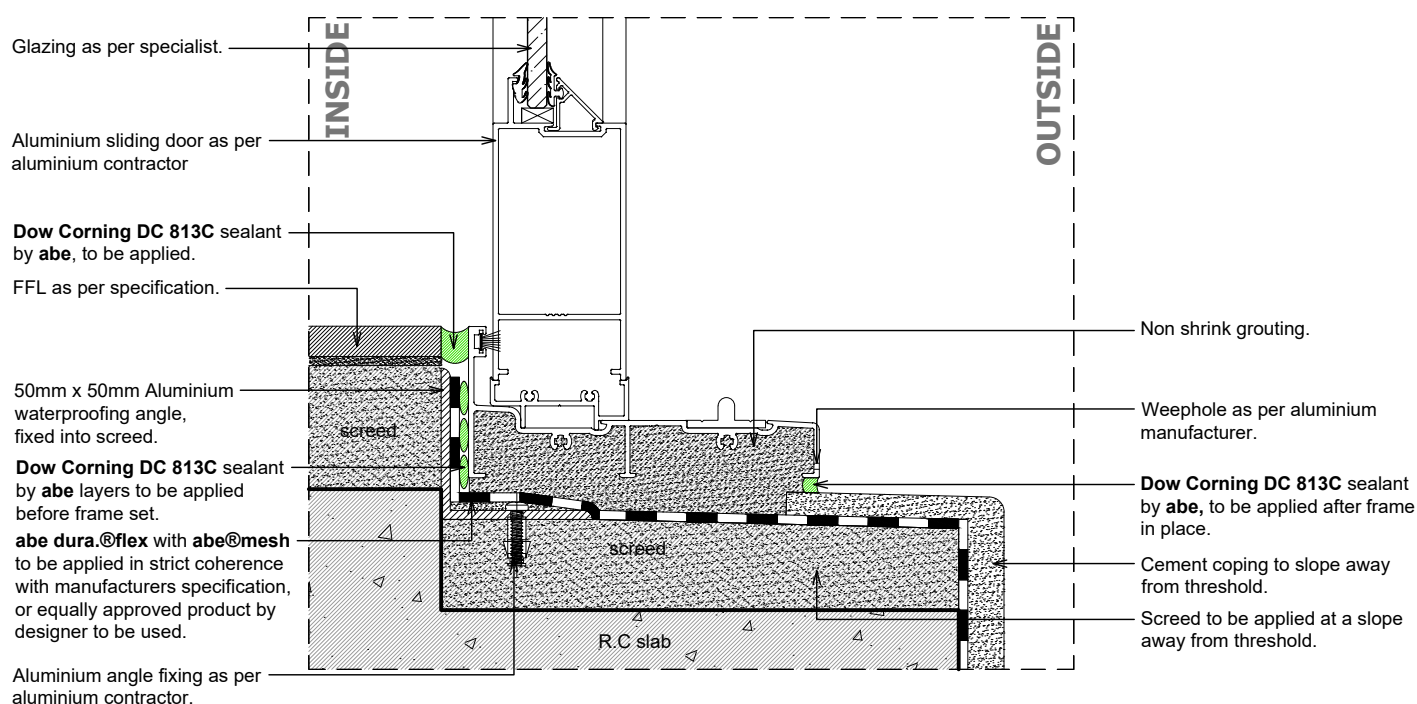**GENERAL NOTE :**

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.

Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.

Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

Glazing as per specialist.

Fixed aluminium shopfront as per aluminium contractor.

Dow Corning DC 813C sealant by **abe**, layers to be applied after frame in place.


FFL as per specification.

50mm x 50mm Aluminium waterproofing angle, fixed into screed.

Dow Corning DC 813C sealant by **abe**, layers to be applied before frame set.

Aluminium angle fixing as per aluminium contractor.

abe dura.@flex with **abe@mesh** to be applied in strict coherence with manufacturers specification, or equally approved product by designer to be used.

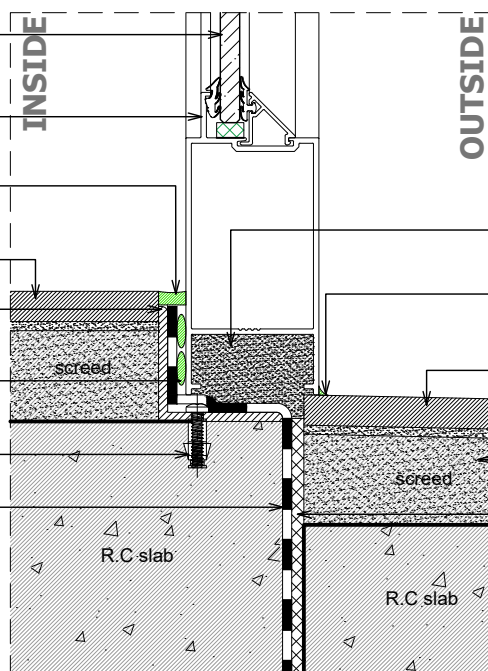

Non shrink grouting.

Dow Corning DC 813C sealant by **abe**, layers to be applied after frame in place.

FFL as per specification to slope away from threshold.

Screed to be applied at a slope away from threshold.

abe dura.@sheet 40 joint former.

Glazing as per specialist.

Fixed aluminium shopfront as per aluminium contractor.

Dow Corning DC 813C sealant by **abe**, layers to be applied after frame in place.


FFL as per specification.

50mm x 50mm Aluminium waterproofing angle, fixed into screed.

Dow Corning DC 813C sealant by **abe**, layers to be applied before frame set.

Aluminium angle fixing as per aluminium contractor.

abe dura.@flex with **abe@mesh** to be applied in strict coherence with manufacturers specification, or equally approved product by designer to be used.

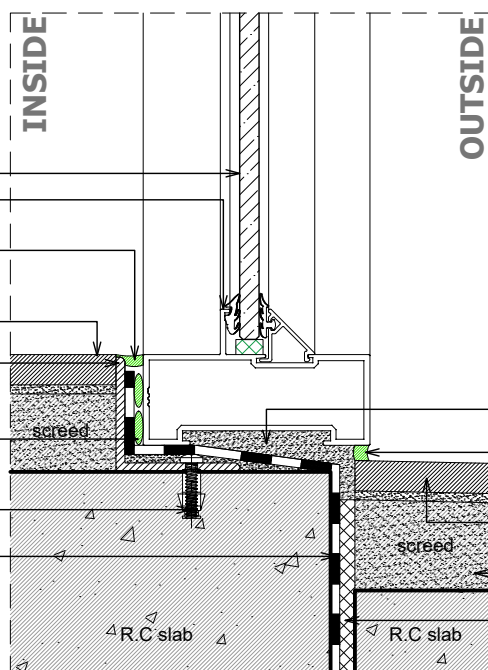

Non shrink grouting.

Dow Corning DC 813C sealant by **abe**, layers to be applied after frame in place.

FFL as per specification to slope away from threshold.

Screed to be applied at a slope away from threshold.

abe dura.@sheet 40 joint former.


GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.


Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.

Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

13

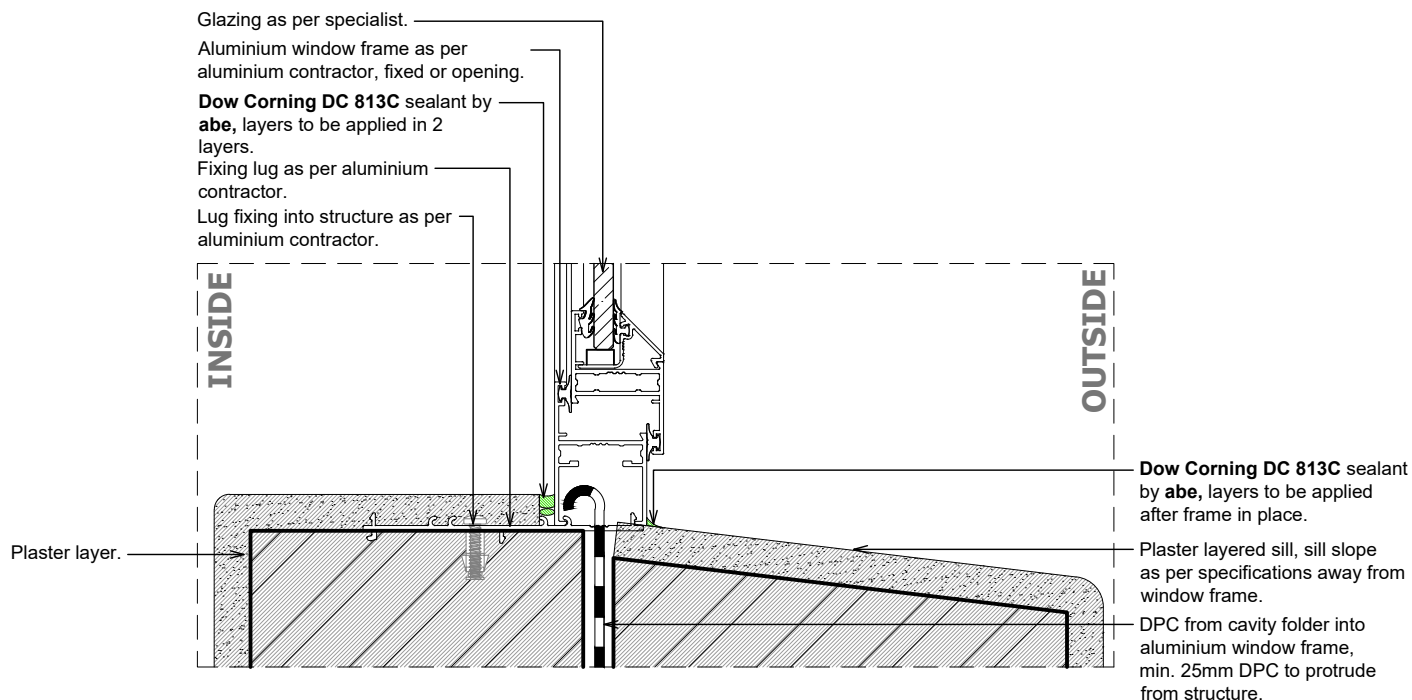

14

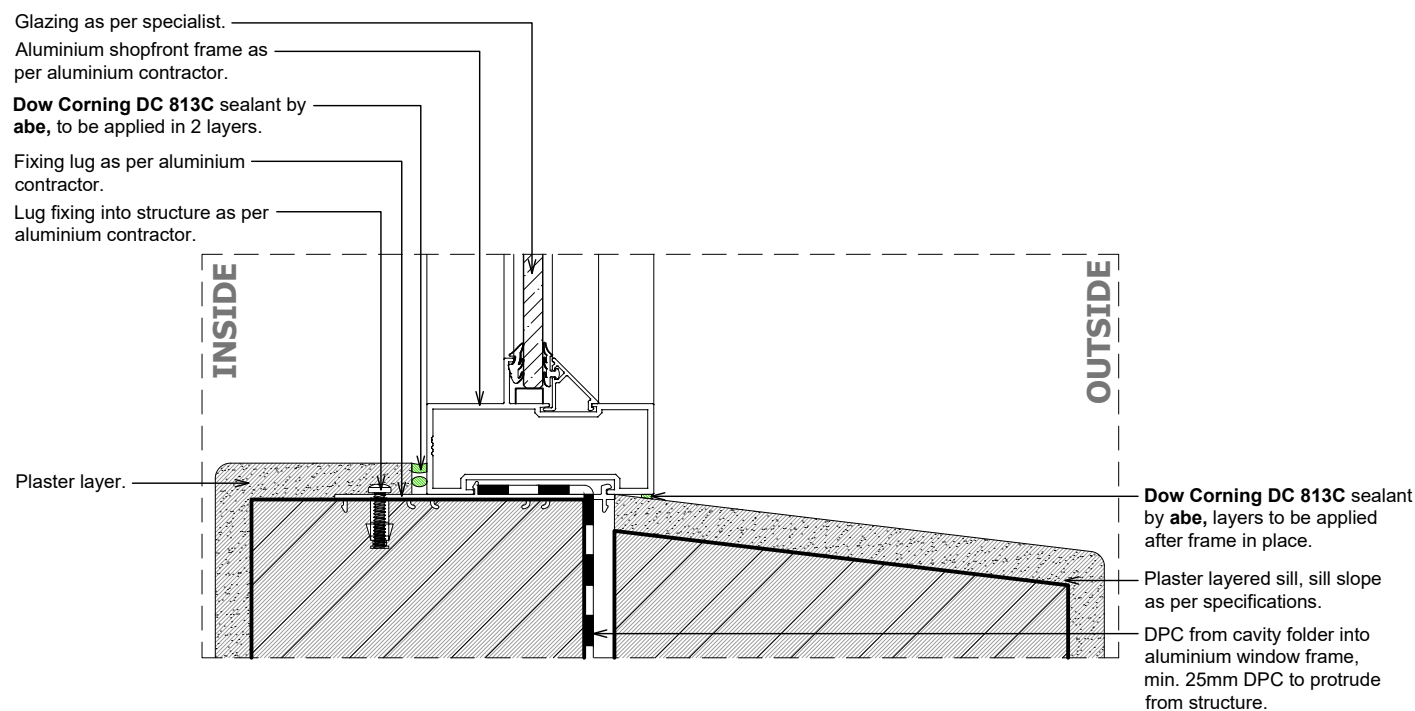


GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.


Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.

Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

15


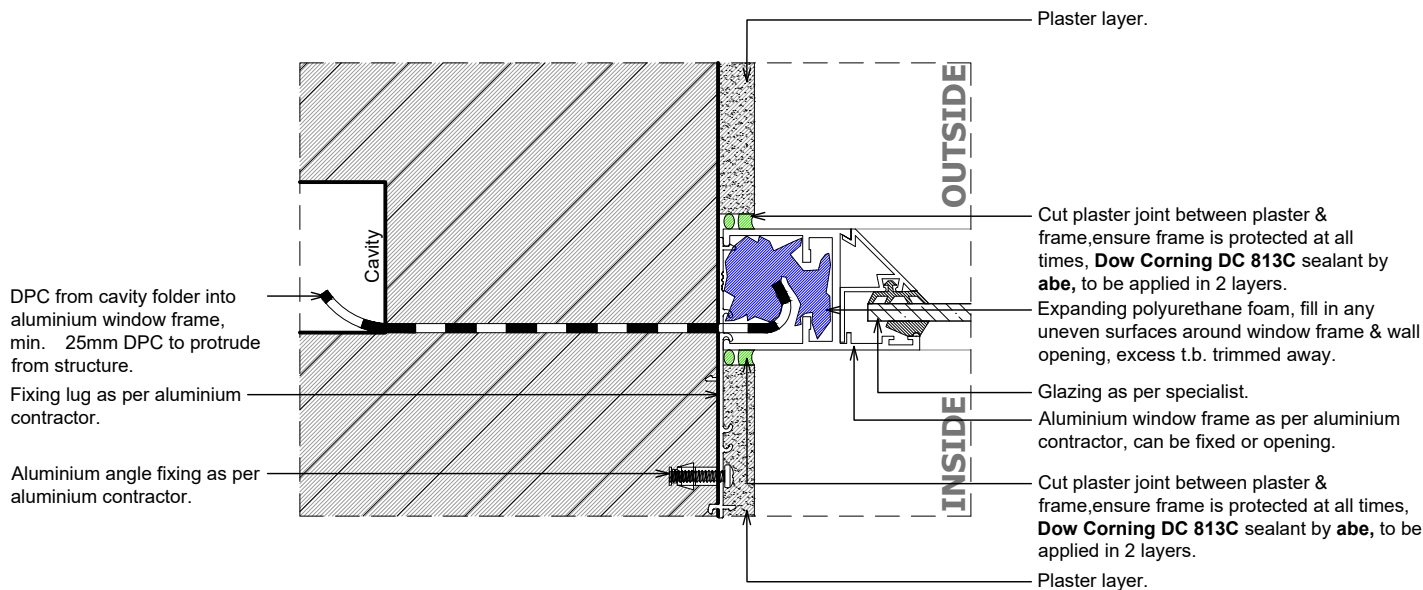


16

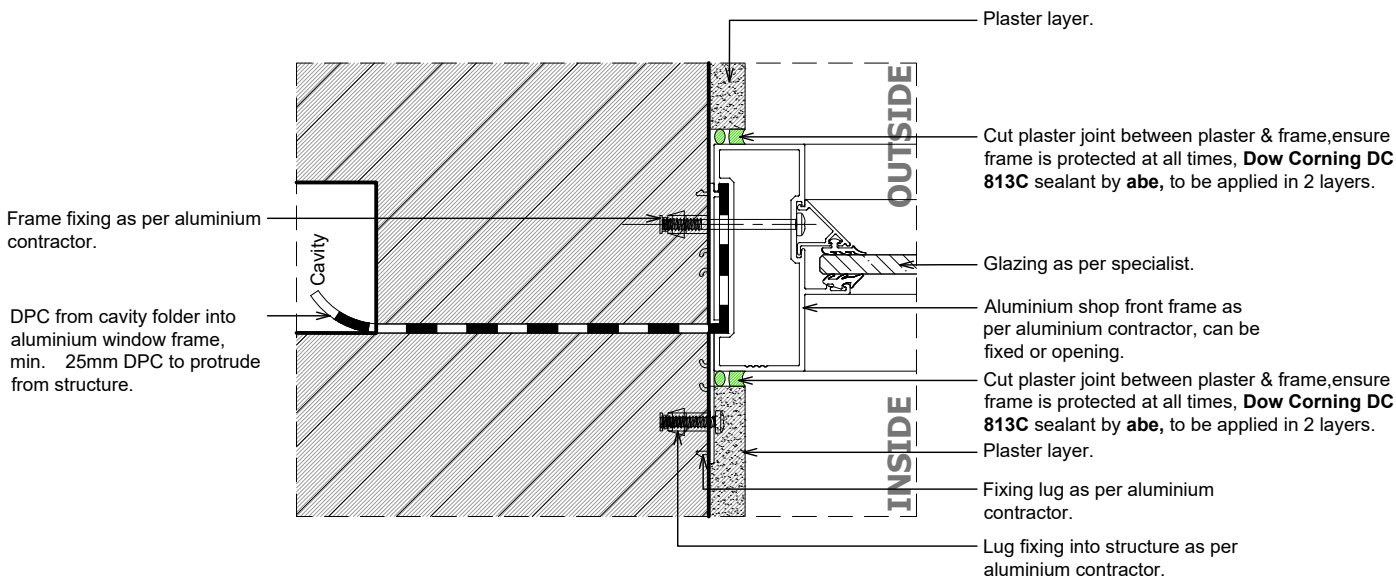

GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.
 Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.
 Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.

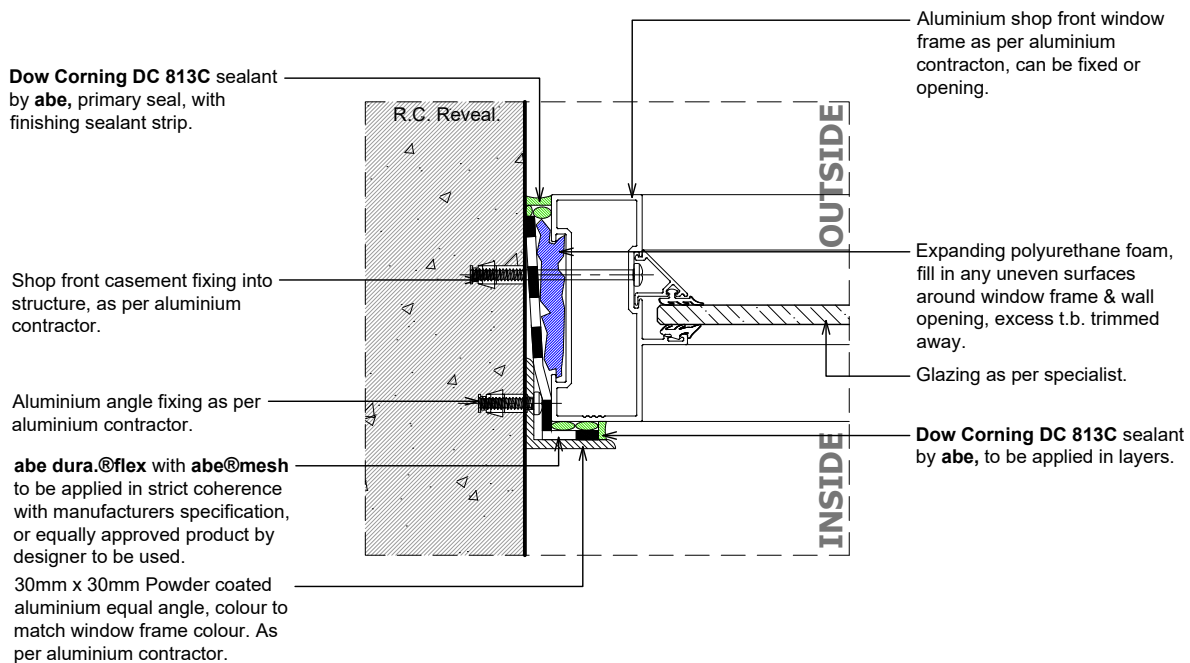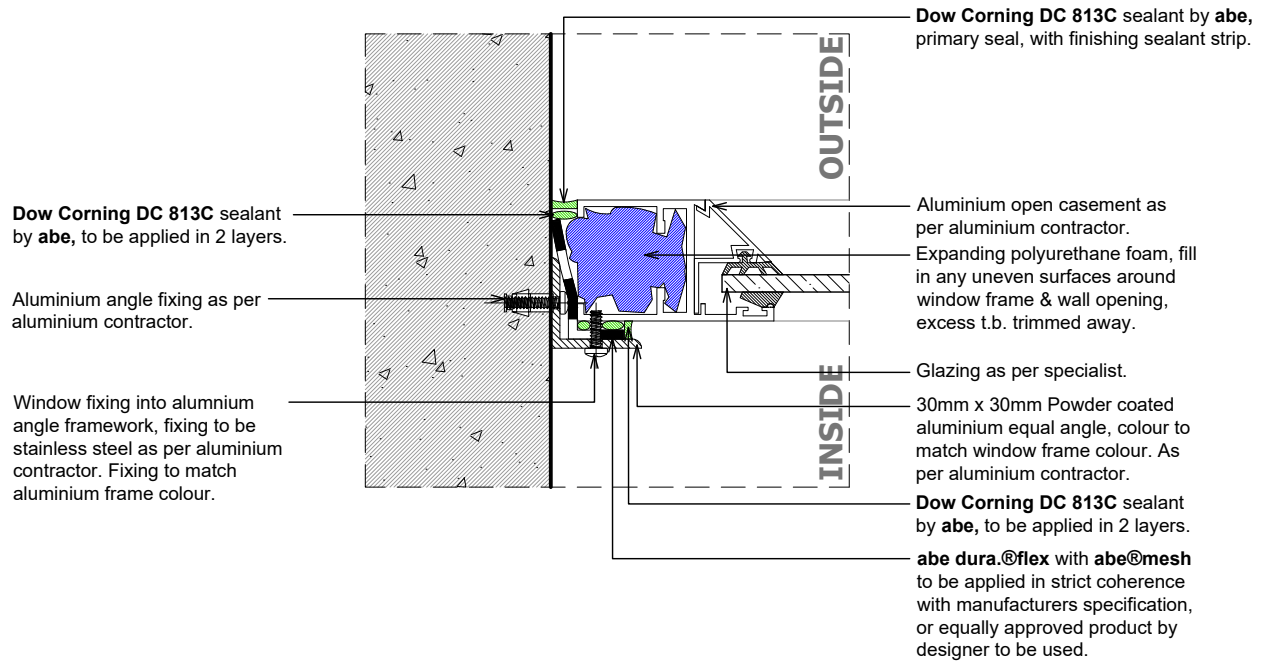

GENERAL NOTE :

Ensure areas are clean, free of dust, where polysulphide sealant/ polyurethane foam applications are required.
Keep solvents like turpentine away of areas to be sealed as it will leave an oily residue. Rather use alcohol based solvents for prepping surface.
Where puncturing through EPDM/ equivalent membrane when fixing frames, fixing punctures to be sealed.